

R E Q U I R E I M M E D I A T E

A C T I O N

No. B-1
Page 1 of 1

28 December, 1979

Robinson Helicopter Company

24747 CRENSHAW BLVD., TORRANCE, CA 90505 TELEPHONE (213) 539-0508

MANDATORY SERVICE BULLETIN

SUBJECT: MAIN ROTOR BLADE INSPECTION

HELICOPTERS AFFECTED: Model R22 Aircraft S/N 0002 thru 0014
Main Rotor Blades S/N 0003 thru 0033

TIME FOR COMPLIANCE: Immediate and during all daily pre-flight inspections.

DESCRIPTION: Visually inspect the trailing edges of the main rotor blades for any indication of separation due to an adhesive failure. Also inspect the edges of the two small external doublers located near the root end of the blades (one on top and one on bottom) for any evidence of delamination.

If an adhesive failure or delamination is found, the aircraft must not be flown and the owner must contact the factory to make arrangements for repairing or replacing the defective blade.

FAA APPROVED